

## Spinner® Bike Pedal Fitment Repair

### Applies to

Models: Spinner® Ride, Shift, and Rally chain and belt drive models.  
 Mfg. Date: 09/19/2016 to 10/14/2016

### Issue/Symptoms

The crank arm pedal mounting hole was not properly machined and the pedal cannot be installed.

### Resolution

Replace defective crank arm (predominately left crank arm).

### Tools required

- 8 mm hex key
- Crank puller
- Torque wrench with 8 mm hex key socket, range 33 ft-lbs (45 Nm)

### Parts required

ID	QT	Part Number	Description
1	1	PPPFT3906220000089	CRANK, LEFT, BELT & CHAIN DRIVE
2	1	PPPFT3906220300089	CRANK, RIGHT, CHAIN DRIVE
3	1	PPP00FT39062101000	CRANK, RIGHT, BELT DRIVE

### Add PI/Bug# information to the Warranty Claim

When submitting a WSCF, please reference PI 1006 on the form. For those currently using Precor Community via Salesforce.com, please add the PI number in the Product Information.

### Procedure

Review entire procedure before starting.

- 1 During the installation assembly, the left and/or right pedal may not fit or thread into the crank arm pedal mounting hole. Replace the defective crank with the new crank arm (left 1 or right 2), see *SBK800 Spinner® Bike Line* service manual – [Crank Arm Replacement](#) procedure.
- 2 Make sure the bike is setting firm on the floor, verify operation and return to service.

